

Product Information TFP-42, -52, -62, -162, -182

FOOD

Temperature Sensor with M12 hygienic



Application / Specified Usage

- · Temperature Measurement in pipes DN15...DN80
- · Temperature measurement in thin-walled pipes and vessels

Application Examples

- · Process monitoring
- · Monitoring of CIP- / SIP-process
- · Temperature measurement in UHT-plants

Hygienic Design / Process Conwnection

- Flow optimized, hygienic and easy sterilizable installation by using Negele weld-in sleeve, e.g. EMK-032 or build-in system, e.g. EHG-... / M12
- Additional process connections: adapters for TriClamp, dairy flange (DIN 11851),
 Varivent, DRD, APV et al
- Sealing system free of elastomers, the connection will be without gaps and crevices
- · Product contacting materials compliant to FDA
- · Sensor completely made of stainless steel

Features / Advantages


- · Integrated transmitter optional
- · Different electrical connections available

Options / Accessories

- · 2 x Pt100 (not retrofittable)
- · 2 x Pt100 with two transmitters (not retrofittable)
- Programmable transmitters MPU-4 as well as MPU-M with output 4...20 mA, 2-wire
- \cdot Integrated transmitters for Profibus PA and HART-protocol
- · Integrated transmitter MPU-LCD with display in connecting head
- · Programming adapter MPU-P 9701
- · Pt100 chip with other classes of accuracy (1/3B, 1/10B)
- · Sensor tips with diameter 3 mm and 4 mm
- Spacer for high temperature up to 250 °C permanent temperature up to 450 °C (on request)
- · Pre-assembled connecting cable for M12-plug
- · Fixed cable in other lengths and other material available
- · Calibration certificate (optional with order)

Authorizations



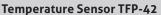



Temperature Sensor TFP-162 with transmitter MPU-M



2

Temperature sensor				
Process connection	thread	M12 CLEANadapt; combined with Negele weld-in sleeves, build-in-systems, adapter sleeves		
Tightening torque		10 Nm		
Insertion length	standard	20500 mm		
Materialis	connecting head thermowell	stainless steel 1.4305 stainless steel 1.4404		
Operating pressure		50 bar maximum		
Temperature ranges	ambient sensor tip	-50+80 °C -50+250 °C		
Sensing resistor	acc. to DIN EN 60751	Pt100		
Electrical connection	cable gland cabel connection fixed cable 2,5 m fixed cable 2,5 m (>90 °C)	M16 x 1,5 M12-plug 1.4305, 4-pins LIYY 4 x 0,25 mm ² PTFE 4 x 0,14 mm ²		
Protection class		IP 69 K (with electrical connection M12-plug)		

Transmitter MPU-4, MPU-10, MPU-H, MPU-M				
Temperature ranges	ambient storage	-40+85 °C -55+90 °C		
Measuring ranges	MPU-4, MPU-H, MPU-M	standard: -1040 °C, 050 / 100 / 150 / 200 °C special ranges free programable standard: -200850 °C configuration occurs with Profibus		
Accuracy	input	< ±0.25 °C		
Temperature drift	zero, span	< 0.01 % / K		
Supply	MPU-M, MPU-4 MPU-10 accuracy	835 V DC 932 V DC 0.01 % / V (reference: 12 V DC)		
Output	signal accuracy burden	analog 420 mA (not for MPU-10) $<\pm0.1$ % of measurement range <600 Ω (at U _B = 24 V)		
Humidity	without condensation	098 %		

Accuracy classes of temperature sensors Tolerances for Pt100 acc. to DIN EN 60751					
Pt100	A	1/3 B	1/10 B		
0°C / 100 Ω	±0.15 K / ±0.06 Ω	±0.10 K / ±0.04 Ω	±0.03 K / ±0.01 Ω		
100 °C / 138.5 Ω	±0.35 K / ±0.13 Ω	±0.27 K / ±0.10 Ω	±0.08 K / ±0.03 Ω		

Electrical Connection FOOD

Electrical connection without transmitter

With 1 x M12 plug

3

4 3


Configuration 1st M12 plug



Electrical connection with transmitter

With M12 plug


Configuration M12 plug

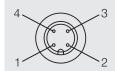

1: + supply 2: - supply 4...20 mA 3: not connected

4: not connected


With 2 x M12 plug

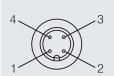

Configuration 2nd M12 plug




With cable gland

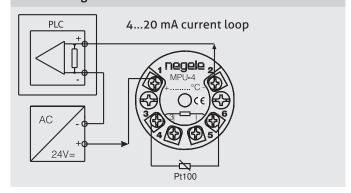

With cable gland


Configuration strip terminal

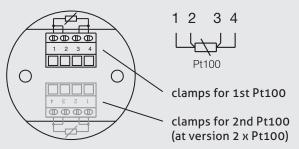

Electrical connection with two transmitter (TFP-62)

With 1 x M12-plug (sensor 1 + sensor 2)

Configuration M12-plug

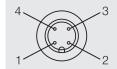

1: + supply (sensor 1)

2: - supply 4...20 mA (sensor 1) 3: - supply 4...20 mA (sensor 2)

4: + supply (sensor 2)

With fixed cable




Fixed cable connection with 1 x Pt100

wh ye bn gn standard rd rd wh wh PTFE

With 2 x M12-plug (sensor 1)

Configuration M12-plug

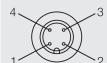

1: + supply (sensor 1)

2: - supply 4...20 mA (sensor 1)

3: not connected

2 4: not connected

Fixed cable connection with 2 x Pt100 (LIYY)

wh ye bn gn 1st Pt100 rd bu pk gy 2nd Pt100




Fixed cable connection with 2 x Pt100 (PTFE)

rd rd wh 1st Pt100 vt vt ye 2nd Pt100



With 2 x M12-plug (sensor 2)

Configuration M12-plug

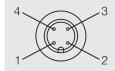


1: + supply (sensor 2)


2: - supply 4...20 mA (sensor 2)


3: not connected

4: not connected

4

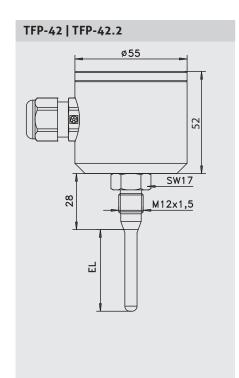

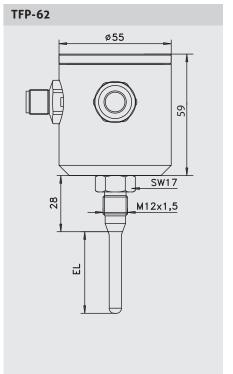


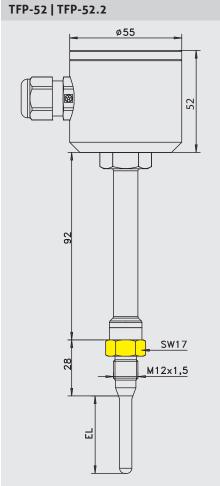



Important advice for TFP-52 und -52.2



Tighten the sensor only at the lower, marked in yellow spanner flat (BE = 17 mm)!

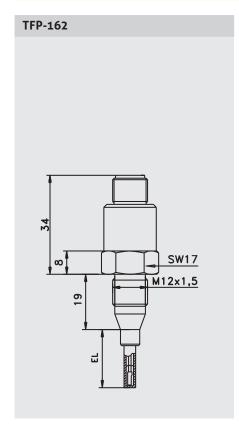


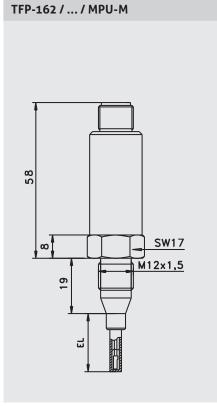


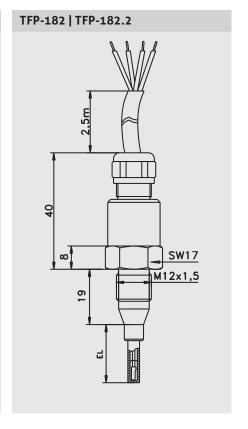


Sensor tip diameter and response time

All temperature sensors are available with smaller sensor tips, to ensure a shorter response time. The below-mentioned times were measured by emersing a temperature sensor from room temperature into boiling water.

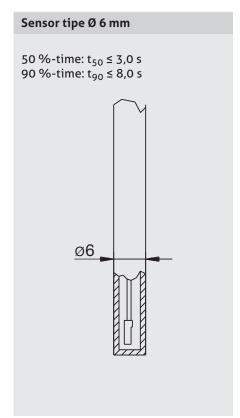

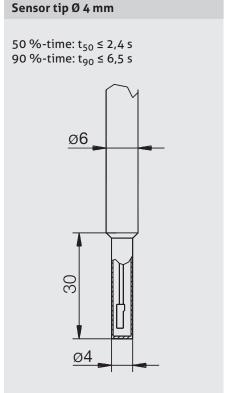

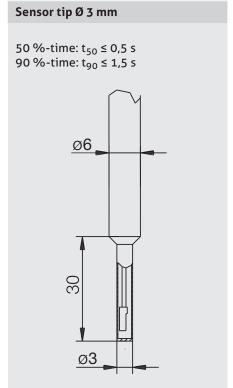

Mechanical Connection / Installation



 Use only Negele CLEANadapt system for safe operation of measuring point!

Conventional Usage



- · Not suitable for applications in explosive areas.
- Not suitable for applications in security-relevant equipments (SIL).

Transport / Storage



- · No outdoor storage
- · Dry and dust free
- Not exposed to corrosive media
- Protected against solar radiation
- · Avoiding mechanical shock and vibration
- · Storage temperature -55...+90 °C
- Relative humidity maximum 98 %

Reshipment



- Sensors shall be clean and free of media or heat-conductive paste and must not be contaminated with dangerous media!
- Use suitable transport packaging only to avoid damage of the equipment!

Cleaning / Maintenance



 In case of using pressure washers, dont't point nozzle directly to electrical connections!

Standards and Guidelines



You have to comply with applicable regulations and directives.

Disposal



- Electrical devices should not be disposed of with household trash. They must be recycled in accordance with national laws and regulations.
- Take the device directly to a specialized recycling company and do not use municipal collection points.

Note on CE



- Applicable directives:
 Electromagnetic Compatibility Directive 2014/30/EU
- Compliance with the applicable EU directives is identified by the CE label on the product.

Option MPU-LCD

(display in the connection head)

The operating company is responsible for complying with the guidelines applicable to the entire installation.

Temperature Transmitter MPU-LCD with Display


Application / Specified Usage

- \cdot 4...20mA transmitter with LCD for Pt100 temperature sensor
- · For installation in temperature sensor
- · Sensor monitoring

Features

- $\cdot\,$ 4-digit display with green backlight
- \cdot Temperature measurement in °C and °F
- · Easy range select by one button
- · Lower costs for wiring because of 2-wire technology

Note

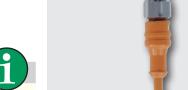

See product information "MPU-LCD" for details.

Order Code FOOD

Order code for version with 1 x Pt100 TFP-42 (connecting head Ø 55 mm) TFP-52 (connecting head Ø 55 with spacer) TFP-162 (connecting head Ø 18 mm, electrical connection via M12-plug) TFP-182 (connecting head Ø 18 mm, electrical connection via 2,5 m PVC-cable; other lengths: see accessories; no transmitter possible!) Sensor length EL in mm 020...500 (in steps of 5 mm) ХХХ (special length) Diameter thermowell in mm (only selectable at sensor length > 30 mm) (only with sensor tip 4 mm) 6 Diameter sensor tip in mm (only with thermowell 6 mm) 3 4 (only with thermowell 6 mm, standard when sensor length ≤ 30 mm) 6 (only with thermowell 6 mm) Accuracy class Pt100 1/3B 1/10B **Electrical connection** (not selectable at TFP-162 and -182) PG (cable gland M16x1,5) M12 (M12 plug, standard with MPU-LCD) **Transmitter** Х (without) for TFP-42 and -52 MPU-4 (programmable) MPU-10 (Profibus PA) MPU-H (HART-protocol) MPU-LCD (with display) only for TFP-162 (not for TFP-182) MPU-M (programmable) Measuring range MPU (only for types with transmitter; not for MPU-LCD) -10...40 (range -10...40 °C) 0...50 (range 0...50 °C) 0...100 (range 0...100 °C) 0...150 (range 0...150 °C) 0...200 (range 0...200 °C) (special range) хх...уу TFP-42/ 050/ 6/ **A**/ PG/ **MPU-4/** 0...100

PVC-cable with M12-connection made of 1.4305, IP 69 K, unshielded M12-PVC / 4-5 m PVC-cable 4-pin, length 5 m PVC-cable 4-pin, length 10 m PVC-cable 4-pin, length 10 m PVC-cable 4-pin, length 25 m PVC-cable with M12-connection, brass nickel-plated, IP 67, shielded M12-PVC / 4G-5 m PVC-cable 4-pin, length 5 m PVC-cable 4-pin, length 5 m PVC-cable 4-pin, length 10 m PVC-cable 4-pin, length 10 m PVC-cable 4-pin, length 10 m PVC-cable 4-pin, length 25 m



Order code for version with 2 x Pt100 TFP-42.2 (connecting head Ø 55 mm, 2 x Pt100, no transmitter possible!) TFP-52.2 (connecting head Ø 55 mm, 2 x Pt100, with spacer, no transmitter possible!) TFP-62 (higher connecting head Ø 55 mm, 2 x Pt100, prepared for 2 x transmitter) TFP-62-H (like TFP-62, but with spacer) (connecting head Ø 18 mm, electrical connection 2,5 m PTFE-cable; other lengths: see at accessories) TFP-182.2 Sensor Length in mm 020...500 (in steps of 5 mm) ххх (special length) Diameter thermowell in mm (only selectable at sensor length > 30 mm) (only with sensor tip 4 mm) 4 6 Diameter sensor tip in mm 3 (only with thermowell 6 mm) (only with thermowell 6 mm, standard when sensor length ≤ 30 mm) (only with thermowell 6) **Accuracy class Pt100** 1/3B 1/10B Electrical connection (only for TFP-42.2 and TFP-52.2) PG (cable gland M16x1,5) 2PG (2 x cable gland M16x1,5) 2M12 (2 x M12-plug) Electrical connection (only for TFP-62 and TFP-62-H) M12 (M12-plug) 2M12 (2 x M12-plug) Continue if TFP-62 or TFP-62-H is selected! No further options for TFP-42.2, -52.2, -182.2! 1. Transmitter MPU-4 (programmable) Measuring Range 1. MPU (measuring range -10...40 °C) -10...40 (measuring range 0...+50 °C) 0...50 (measuring range 0...+100 °C) 0...100 (measuring range 0...+150 °C) 0...150 (measuring range 0...+200 °C) 0...200 (special range) хх...уу 2. Transmitter MPU-4 (programmable) Measuring Range 2. MPU (-10...40 °C) -10...40 0...50 (0...+50 °C) 0...100 (0...+100 °C) 0...150 (0...+150 °C) 0...200 (0...+200 °C) (special) хх...уу TFP-62 / 100/ 6/ **X**/ A / M12/ MPU-4/ 0...50/ **MPU-4/** 0...50